

No. 106 / POL 2 3rd prolongation (1st prolongation after installation inrun track system)

CERTIFICATE OF JUMPING HILL CERTIFICAT DE CONFORMITE SCHANZENPROFILBESTÄTIGUNG

Date of issue 07.04.2019
Établi le
Ausgestellt am

Valid till 31.12.2023
Valable jusq' au
Gültig bis


Place: Wisla

Name: Malinka Adama Malysza

HS = 134 m

$h/n = 0,576$

$Vo = 25,76$ m/s

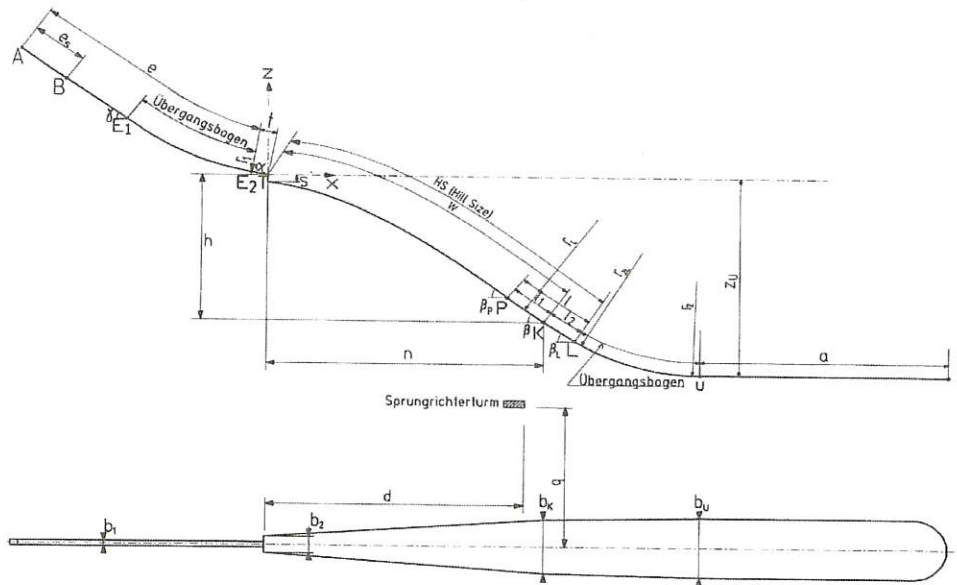

$e = 88,20$ m	$l_1 = 14,00$ m	$P = 106,00$ m
$e_s = 16,00$ m 32 gates á 50cm	$l_2 = 14,00$ m	$K = 120,00$ m
$t = 6,60$ m	$a = 61,10$ m 23° sloping up	$L = 134,00$ m
$\gamma = 35,00$ °	$\beta_p = 37,50$ °	$b_1 = 2,56/3,50$ m
$\alpha = 10,50$ °	$\beta = 34,80$ °	$b_K = 24,00$ m
$r_1 = 97,00$ m	$\beta_L = 32,30$ °	$b_A = 26,40$ m
$h = 59,83$ m	$r_L = 320,00$ m	$d = 84,00$ m
$n = 103,81$ m	$r_2 = 94,40$ m	$q = 40,00$ m
$s = 3,10$ m		$Z_u = 81,30$ m

Remarks / Bemerkungen

- inspection by Josef Slavik (05th Dezember 2018)
- the remarks of the inspection-reports must be observed and fulfilled for the validity of certification.
- for fulfilling the FIS-ICR standards of the skijumping hill, the owner is responsible during training and competition.

JUMPING HILL APPROVED BY THE FIS
TREPLIN HOMOLOGUE PAR LA FIS
DURCH DIE FIS GENEHMIGTE SPRUNGSCHANZE

SUB-COMMITTEE FOR JUMPING HILLS

CHAIRMAN:

Hans-Martin Renn